

tSH-700 RevB / RevB2 Series

Firmware Update via Ethernet

Version: 1.4/Updated: Feb. 2024

SUPPORT

Models supported include tSH-722, tSH-732, tSH-725, tSH-735, tSH-724, tSH-734, tSH-722i, tSH-732i, tSH-725i, tSH-735i, tSH-724i and tSH-734i.

WARRANTY

All products manufactured by ICP DAS are warranted against defective materials for a period of one year from the date of delivery to the original purchaser.

WARNING

ICP DAS assumes no liability for damages consequent to the use of this product. ICP DAS reserves the right to change this manual at any time without notice. The information furnished by ICP DAS is believed to be accurate and reliable. However, no responsibility is assumed by ICP DAS for its use, nor for any infringements of patents or other rights of third parties resulting from its use.

COPYRIGHT

Copyright © 2024 by ICP DAS. All rights are reserved.

TRADEMARKS

Names are used for identification purposes only and may be registered trademarks of their respective companies.

CONTACT US

If you have any questions, please feel free to contact us via email at:

service@icpdas.com

Ch. 0. How to identify your tSH-700_RevB type

Ch. 1. Setting up the tSH-700_RevB Module

Ch. 2. Firmware Update Procedure

Ch. 3. Troubleshooting

Ch. 4. Additional Information



ICP DAS CO., LTD.

Website: <http://www.icpdas.com>

0. How to identify your tSH-700^{RevB / RevB2} module

Note: In this document, tSH-700_RevB will represent both the tSH-700 RevB and tSH-700 RevB2 modules.

When your tSH-700_RevB series module needs a firmware update, please check the module name on the front panel that without “RevB” or “RevB2” are not applicable to this firmware update, as shown in the figure below:



Module Name: **tSH-700**
Not applicable to this Firmware update manual.



Module Name: **tSH-700^{RevB / RevB2}**
Firmware file: **tSH700_RevBxxx_xxxxxx.zip**

1. Setting up the tSH-700_RevB Module

Before updating the firmware, please ensure that the network settings for both your host computer and tSH-700_RevB modules are correctly configured, or the update procedures via the Ethernet network may not function correctly.


Step 1: Connect the tSH-700_RevB to the same hub or the same sub-network as your Host PC, and attach a power supply to the tSH-700_RevB. Do not connect the tSH-700_RevB to a router or directly to the Internet as this may cause the update process to fail.

Please refer to “Chapter 3-Connecting the Power and Host PC” in the tSH-700_RevB Quick Start Guide for more detailed information.




[Download the Quick Start Guide.](#)

Step 2: Install the eSearch Utility on your Host PC, and then run the Utility to search for tSH-700_RevB modules connected to the network.

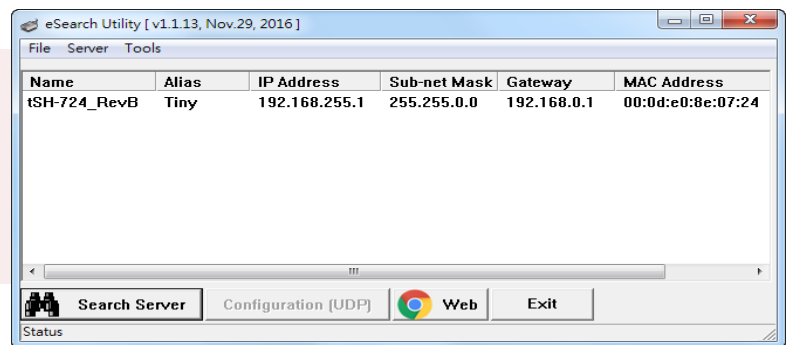

[Download the eSearch Utility.](#)

Step 3: Configure the correct network settings for the required tSH-700_RevB module.

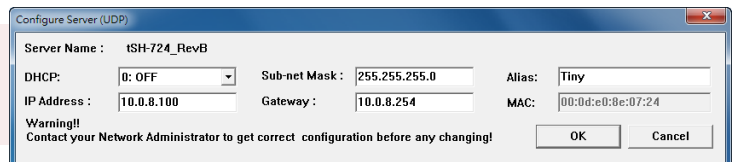

Refer to “Chapter 5-Configuring the Correct Network Settings” in the tSH-700_RevB Quick Start Guide. If the IP address settings do not work correctly, refer to [note1 \(Page 24\)](#) below.



[Download the Quick Start Guide.](#)

2. Firmware Update Procedure

The firmware update can fail when the computer has multiple network interfaces (e.g., LAN and Wi-Fi). Therefore, enable only one network interface for updating the firmware, and temporarily turn off other network interfaces, firewalls, anti-virus software, VPN, VirtualBox, VMWare first.

2.1 tSH-700 RevB Firmware Update

The “**Local Firmware Update**” method requires the user to manually adjust the position of the Init/Run Switch and reboot the module in order to initialize the firmware update. Refer to [Section 2.1.1 “Local Firmware Update”](#) for more details.


The “**Remote Firmware Update**” method allows the user to initialize the module via a web interface without needing to adjust the hardware switch. Initialization via the web interface is useful when the module is installed at a remote site and can be accessed via the TeamViewer application installed on a remote PC. Refer to [Section 2.1.2 “Remote Firmware Update”](#) for more details.

2.1.1 Local Firmware Update

Step 1: In the eSearch Utility, click the “**Search Servers**” button to search for any tSH-700_RevB modules connected to the network . (The network settings as described in Step 3 on Page2)

Step 2: **Right click** on the name of the tSH-700_RevB module to be updated.


Step 3: Select the “**Firmware Update**” item.

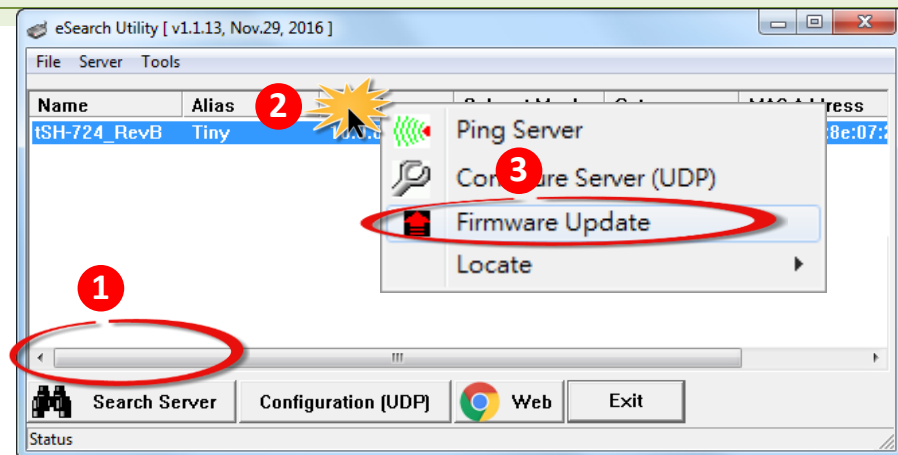

Step 4: In the “Open” dialog box, select the firmware file (*tSH700_RevB.dat*) that will be used to update the module and then click the “Open” button.




[Download the Firmware File.](#)

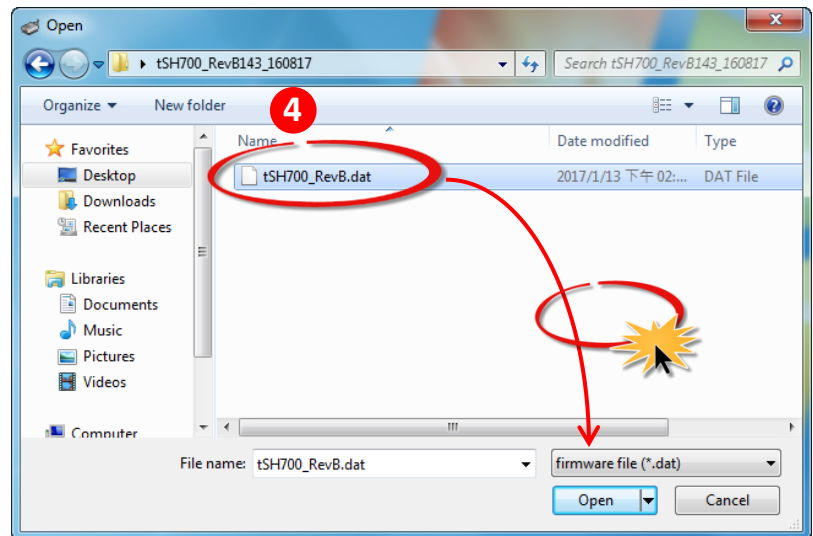


Step 5: Assign a **valid IP Address** (can be different with the current IP) and the **factory-default MAC Address** for the tSH-700_RevB module. If this IP address is invalid (e.g. IP Address: 0.0.0.0) or a user-defined MAC address is assigned. Refer to **note 2 (Page 24)** and **note 3 (Page 25)** for more details.

Step 6: Click the “OK” button.

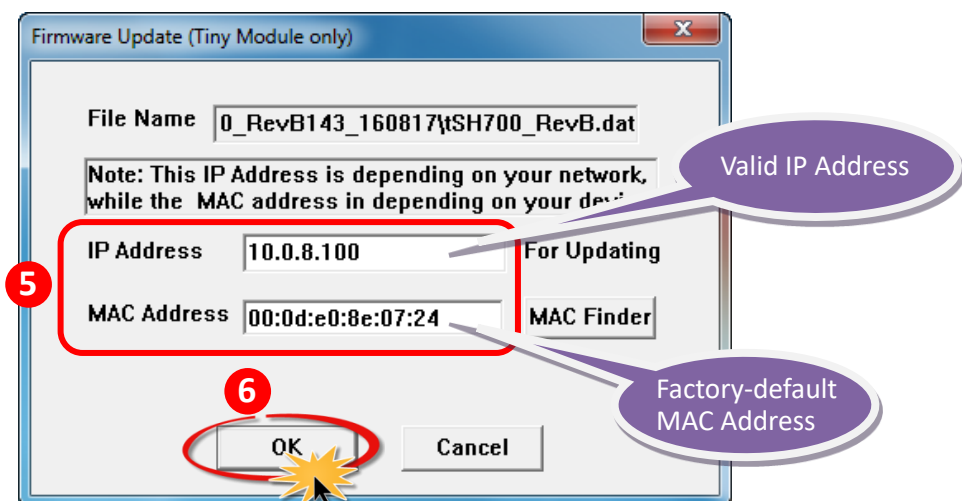

Step 7: You are now ready to update the firmware. A command prompt window will appear to show the progress of the update.

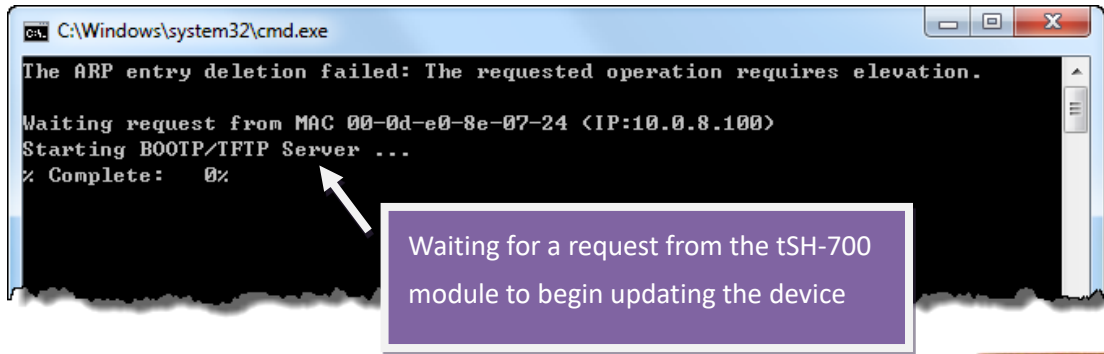


Step 8: Set the tSH-700_RevB module to "Init Mode".



Step 9: Power-on reset the tSH-700_RevB module in "Init Mode" to initiate the update.

Step 10: Confirm that the two MAC addresses (factory-default) listed in the Command Prompt window, "Waiting request from MAC x.x.x.x" and "BOOTPREQ from MAC: x.x.x.x", are the same, as indicated in the image below. If these addresses do not match, the update cannot proceed. Refer to *note4 (Page 25)* below for more details.

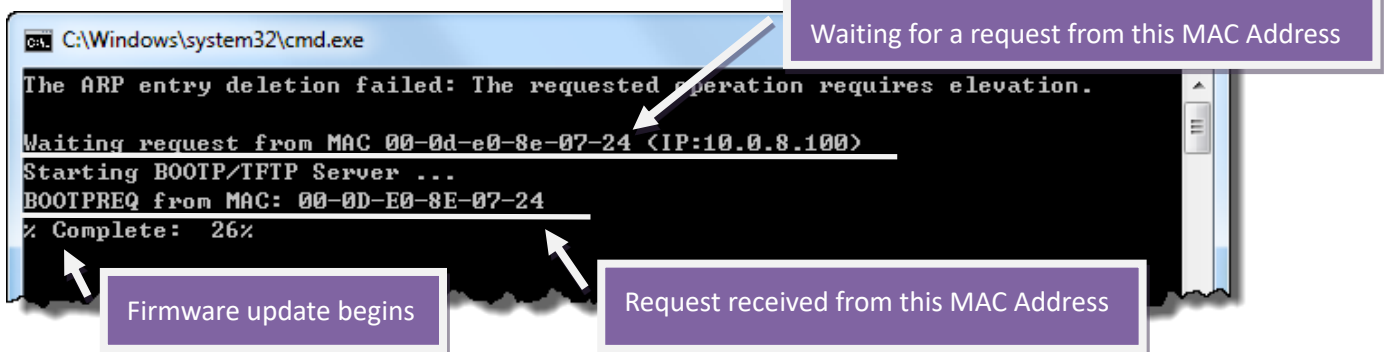




Step 11: Once the update is complete (i.e., when the progress indicator reaches 100%), set to **“Run Mode”**.

Step 12: **Power-on reset** the tSH-700_RevB module.

Step 13: In the eSearch Utility, search for the tSH-700_RevB module again to verify that it is functioning correctly. **Note that the settings of the module may need to be reconfigured after updating the firmware. Refer to Step 3 in Chapter 1 above for more details.**

Step 14: Click the name of the tSH-700_RevB module.

Step 15: Click the **“Web”** button and the default web browser will be opened.

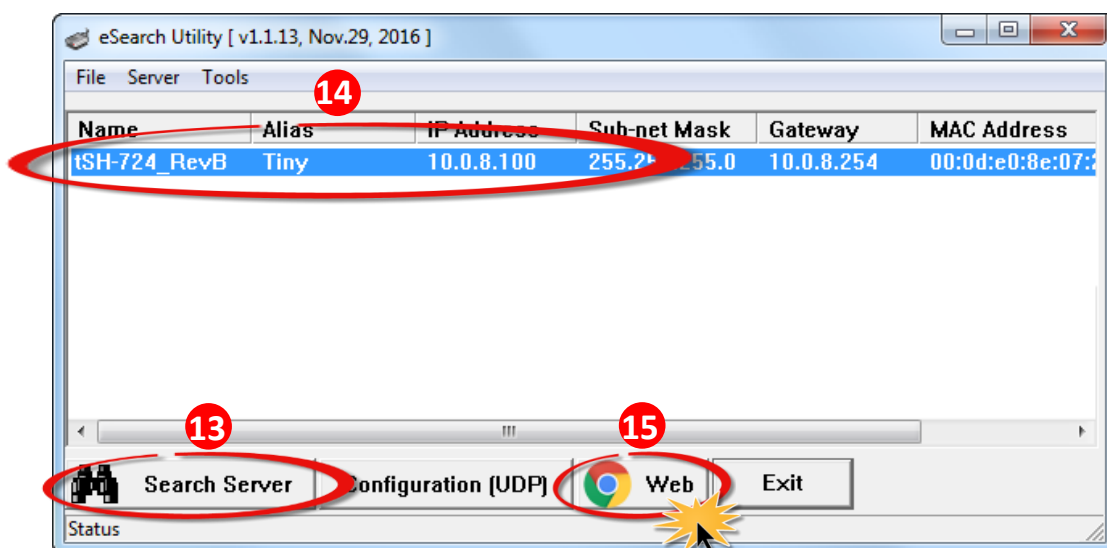

Step 16: A new password is required before the first login. Enter the default password “admin” in the “Current password” field , and enter the new password in both the “New password” and “Confirm new password” fields.

Step 17: Verify that the firmware version and date details are correct.

Tiny Serial Port Sharer

Home | Application Mode | Port1 | Port2 | Network | Filter | Monitor | Password | Logout

Change Password
The length of the password is 12 characters maximum.
Change-password is required if the current password is same as factory setting.

Current password

New password

Confirm new password

Tiny Serial Port Sharer

Home | Application Mode | Port1 | Port2 | Network | Filter | Monitor | Password | Logout

The system is logged out.
To enter the web configuration, please type password in the following field.

Login password

Tiny Serial Port Sharer

Home | Application Mode | Port1 | Port2 | Network | Filter | Monitor | Password | Logout

Model Name	tSH-725(t)_RevB2	Alias Name	Tiny
Firmware Version	B2.0.7 [Aug.28 2023]	MAC Address	00-0d-e0-81-88-07
IP Address	10.0.8.100	TCP Command Port	10000
Initial Switch	OFF	System Timeout (Network Watchdog, Seconds)	0

Current port settings:

Port Settings	Port 1	Port 2
Baud Rate (bps)	115200	115200
Data Size (bits)	8	8

Settings... / Every visit to the page


© 2023 ICP DAS Co., Ltd. All rights reserved

Complete

2.1.2 Remote Firmware Update

In order to perform a Remote Firmware Update, use an application that allows an external system to be remotely controlled, such as TeamViewer, in order to create a connection between the local and the remote system. **Note that all firmware update procedures need to be carried out on the remote system.**

User is there remotely controlling the firmware update procedures.

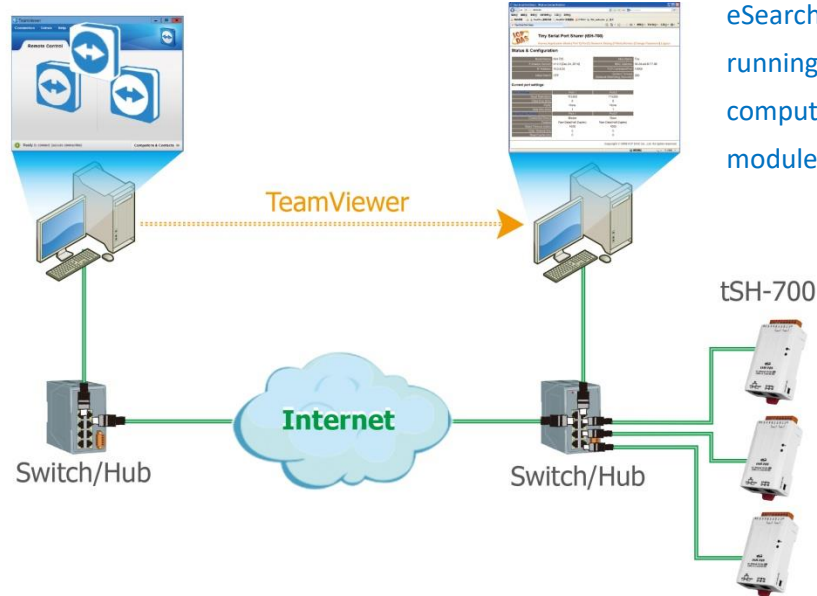


eSearch Utility is running on the computer to update module's firmware.

Follow the procedure described below to update firmware of the tSH-700_RevB on the remote PC:

Step 1: In the eSearch Utility, click the **“Search Servers”** button to search for any tSH-700_RevB modules connected to the network . (The network settings are described in **Step 3 of Chapter1**)

Step 2: Right click the name of the tSH-700_RevB module to be updated.


Step 3: Select the **“Firmware Update”** item.

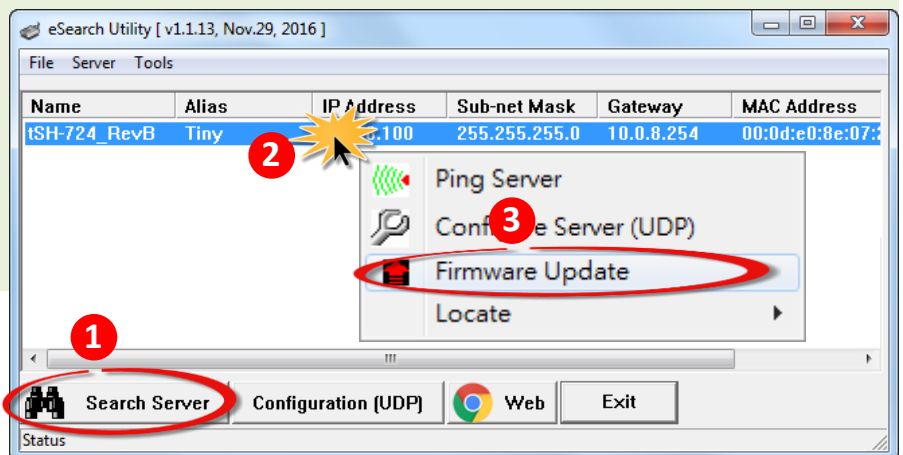

Step 4: In the “Open” dialog box, select the firmware file (*tSH700_RevB.dat*) that will be used to update the module and then click the “Open” button.




[Download the Firmware File.](#)

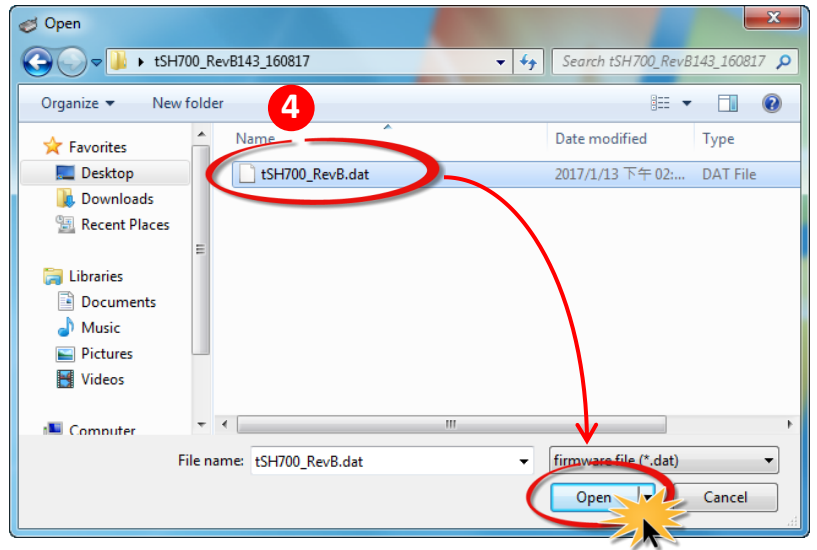


Step 5: Assign a **valid IP Address** (can be different with the current IP) and the **factory-default MAC Address** for the tSH-700_RevB module. If this IP address is invalid (e.g. IP Address: 0.0.0.0) or a user-defined MAC address is assigned. Refer to [note 2 \(Page 24\)](#) and [note 3 \(Page 25\)](#) for more details.


Step 6: Click the “OK” button.

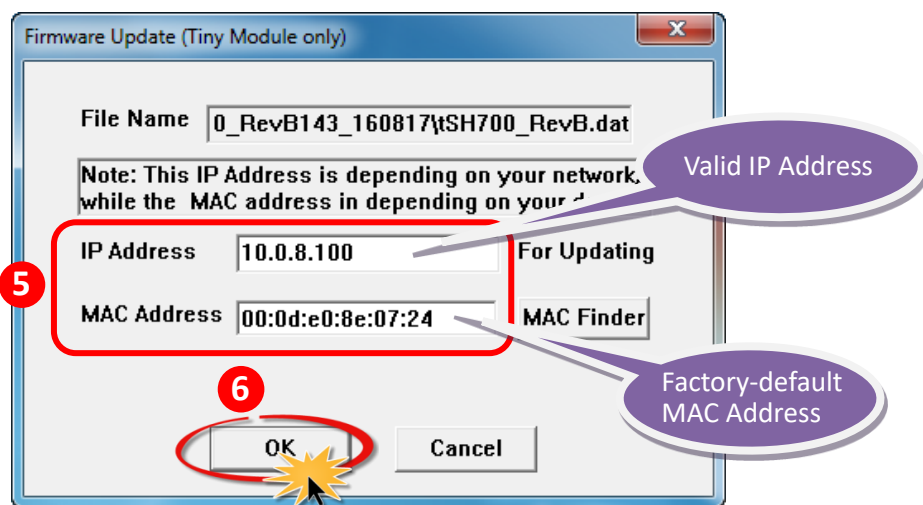

Step 7: You are now ready to update the firmware. A command prompt window will appear to show the progress of the update.

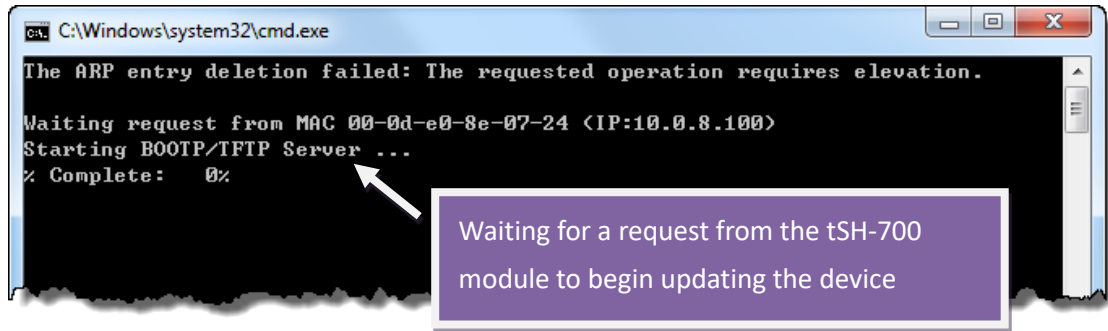

Step 8: Open a web browser and enter the URL for the tSH-700_RevB in the address bar of the browser and log in to the web configuration pages.

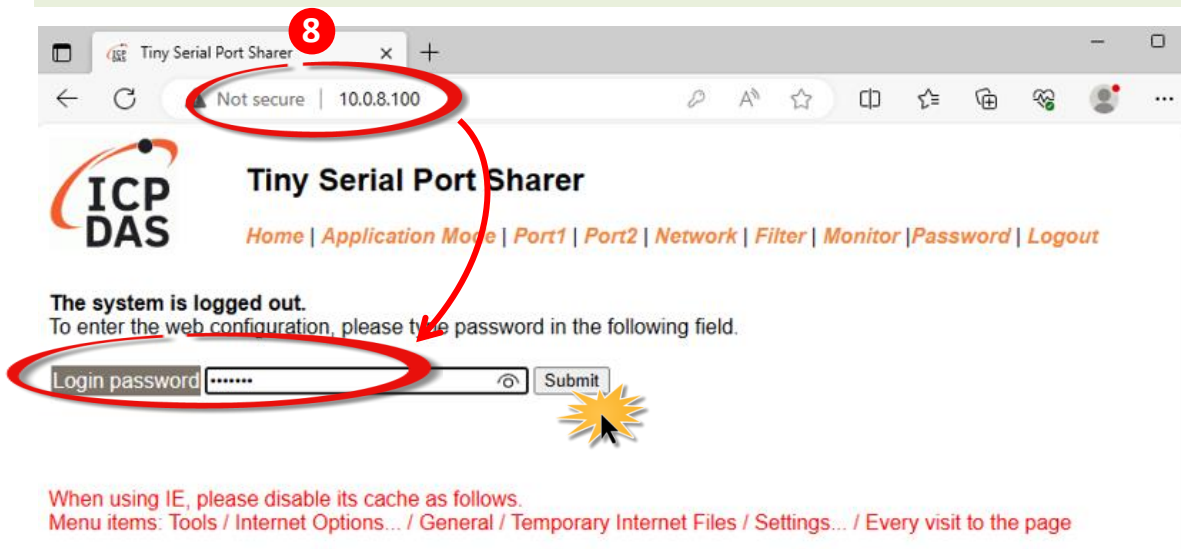

Step 9: Click the **“Network”** tab to display the Network Settings page.

Step 10: Click the **“Update”** button in the **“Firmware update via Ethernet”** section to start the update.

The screenshot shows the Tiny Serial Port Sharer web interface. The browser address bar shows the URL 10.0.8.100. The page title is "Tiny Serial Port Sharer". The navigation menu includes "Home", "Application Mode", "Port1", "Port2", "Network", "Filter", "Monitor", "Password", and "Logout". The "Network" tab is selected and circled in red with a red circle containing the number 9. Below the navigation menu, there is a table with the following sections:

UDP Alarm	
Alarm IP Address(UDP)	0 . 0 . 0 . 0 - Reserved
Alarm Port(UDP)	54300
Misc.	
Alias Name	Tiny (Max. 19 chars)
Debug Message(UDP)	0 (1 ~ 255 seconds, 0=default disable) - Reserved


Below the table is an "Update Settings" button. Under the "Other Operations" section, there are three rows:

Restore all options to their factory default states	Restore Defaults
Reboot the module	Reboot
Firmware update via Ethernet If the remote firmware update is failed, then on-site firmware update is required to make the module working again. Step 1: Refer to firmware update manual first. Step 2: Run eSearch Utility to prepare and wait for update. Step 3: Click the [Update] button to reboot the module and start update. Step 4: Configure the module again.	Update

The "Update" button in the "Firmware update via Ethernet" section is circled in red with a red circle containing the number 10. At the bottom of the page, the copyright notice reads: "Copyright © 2023 ICP DAS Co., Ltd. All rights reserved."

Step 11: Confirm that the two MAC addresses (factory-default) listed in the Command Prompt window, "Waiting request from MAC x.x.x.x" and "BOOTPREQ from MAC: x.x.x.x", are the same, as indicated in the image below. If these addresses do not match, the update cannot proceed. Refer to note4 (Page 25) below for more details.

Step 12: Once the update is complete (i.e., when the progress indicator reaches 100%), close the Command Prompt window.

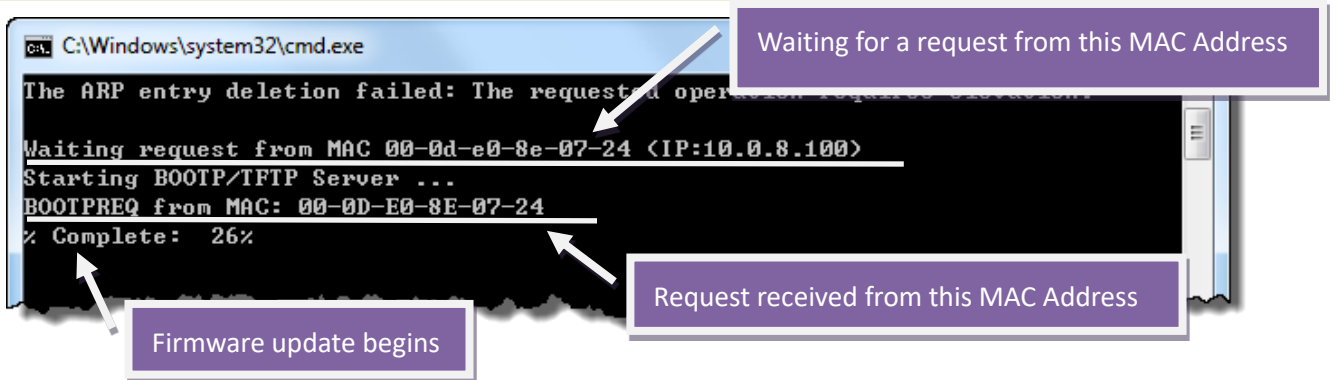


Note: If the Remote Firmware Update method fails, please refer to [Section 3.1 Firmware update in BOOT mode \(local operation\)](#) to restore the module.

Step 13: In the eSearch Utility, search for the tSH-700_RevB module again to verify that it is functioning correctly. **Note that the settings of the module may need to be reconfigured after updating the firmware. Refer to Step 3 in Chapter 1 above for more details.**




Step 14: Click the name of the tSH-700_RevB module to highlight it.

Step 15: Click the "Web" button and the default web browser will be opened.

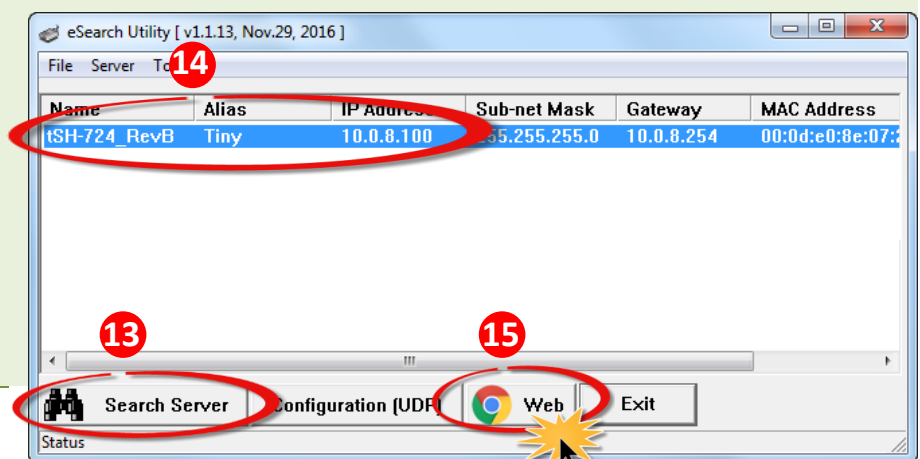

Step 16: A new password is required before the first login. Enter the default password "admin" in the "Current password" field, and enter the new password in both the "New password" and "Confirm new password" fields.

Step 17: Verify that the version and date details for the firmware are correct.

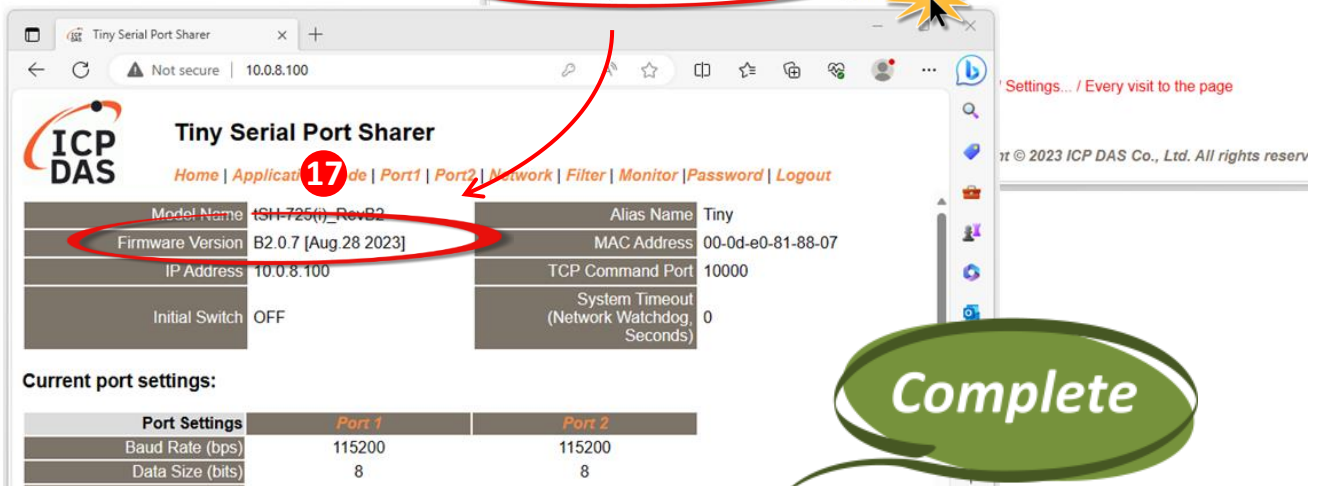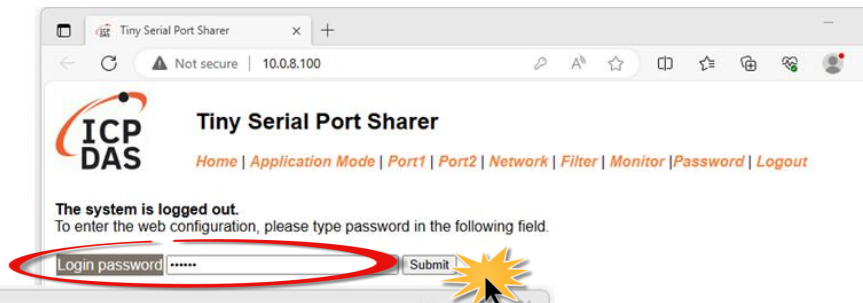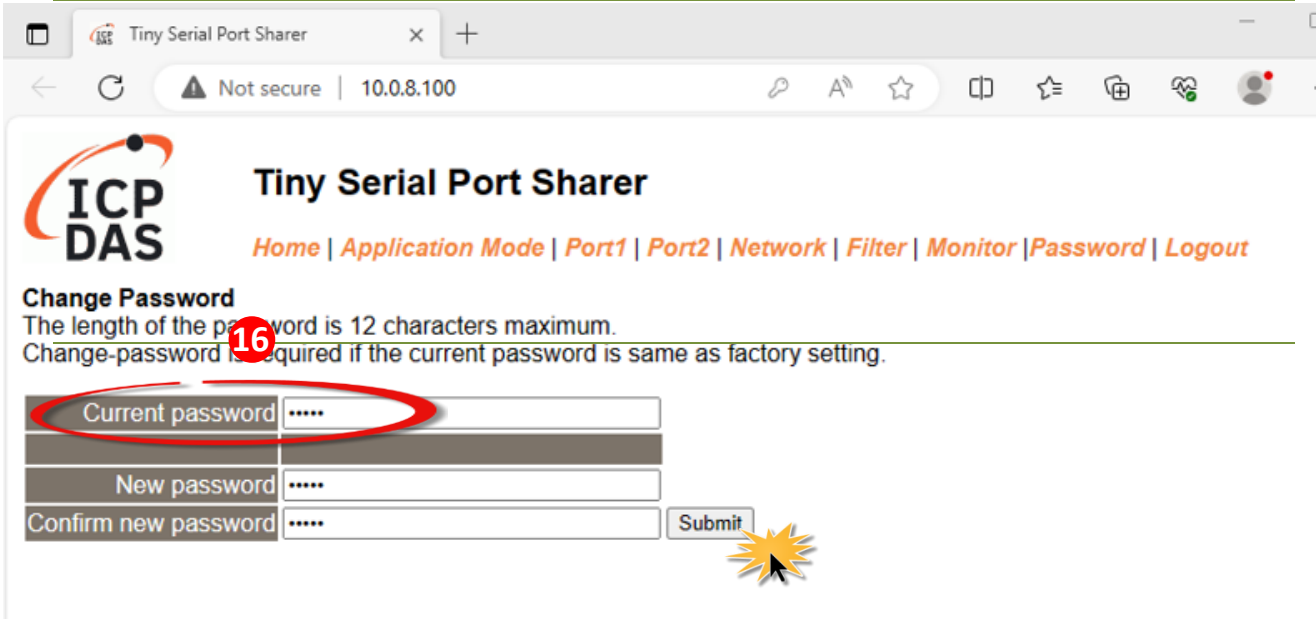


3. Troubleshooting

3.1 Firmware update in BOOTP mode

If the module is not functioning correctly (e.g. there is no response to the search request, or if the system LED is always displayed as either off or on), please download a new firmware from the ICPDAS web site and then update the firmware for the module using the following procedure.


Step 1: In the eSearch Utility, select the "BOOTP" item from the "Server" menu. A check mark should be displayed next to the item after it has been selected.

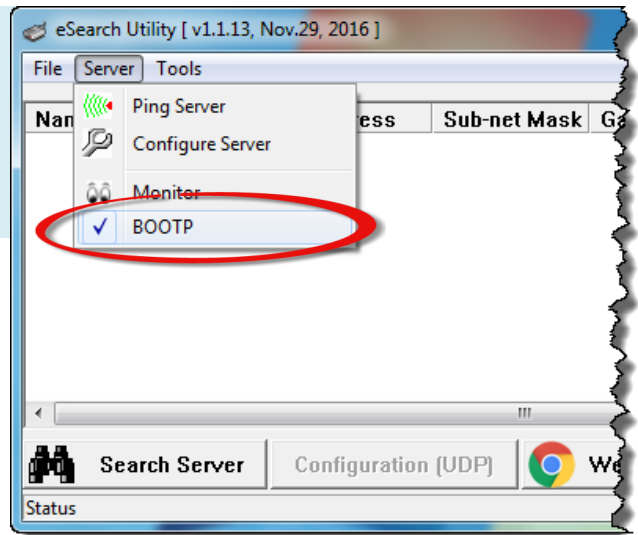


Step 2: Set to "Init Mode".

Step 3: Power-on and reboot the tSH-700_RevB module and then click the "Search Servers" button to search for the tSH-700_RevB module at the same time. Note, the module sends BOOTP messages about 5 seconds when booting in Init Mode. If this step is not successful, reboot the module and execute the search again.


Step 4: Right click on the name "BOOTP" and then select the "Firmware Update" item from the popup menu.

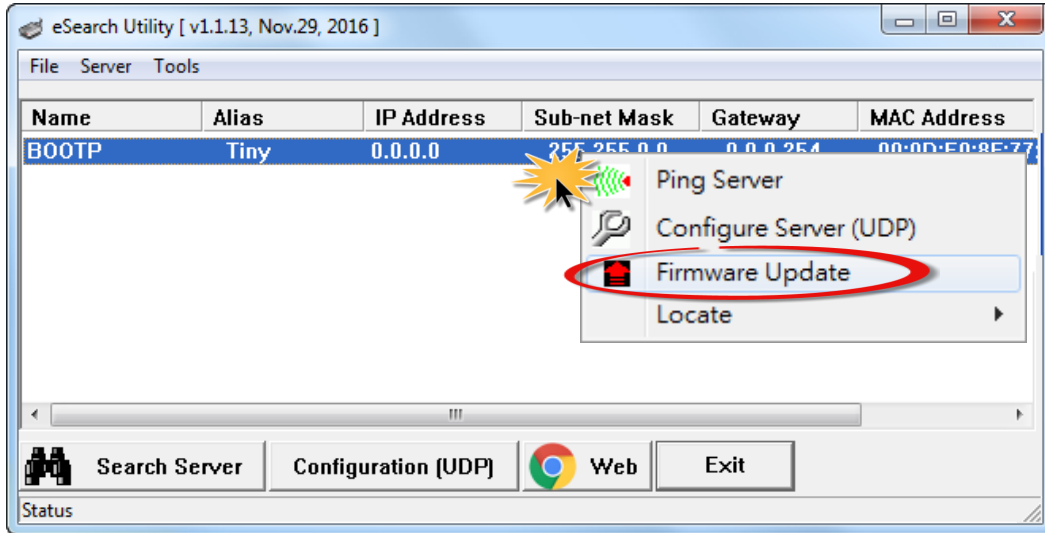

Step 5: Refer to Steps 4 to 17 in "Chapter 2-Firmware Update Procedure" for details of how to complete the update process. Note, the module will response with no IP address in the BOOTP mode. User has to assign a valid IP manually in step 5 of page 4.

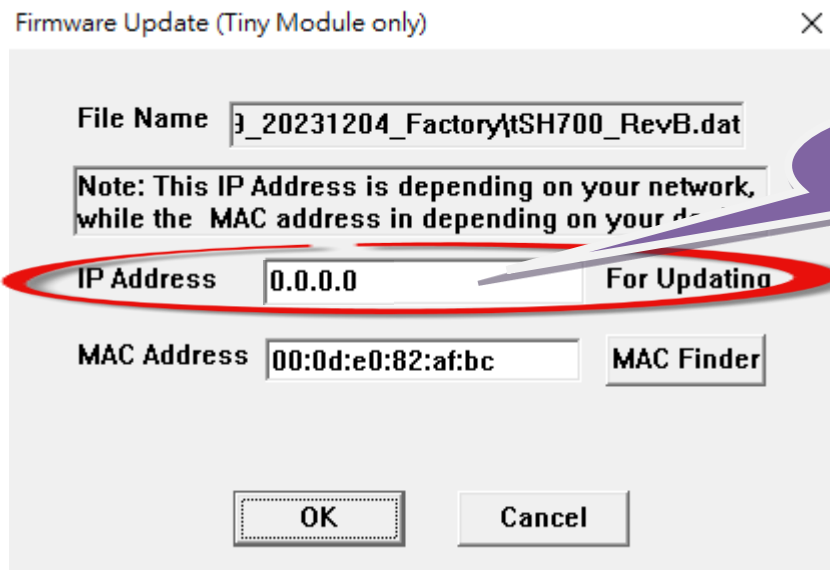

Step 6: After updating the firmware, **disable BOOTP mode** from the eSearch utility.

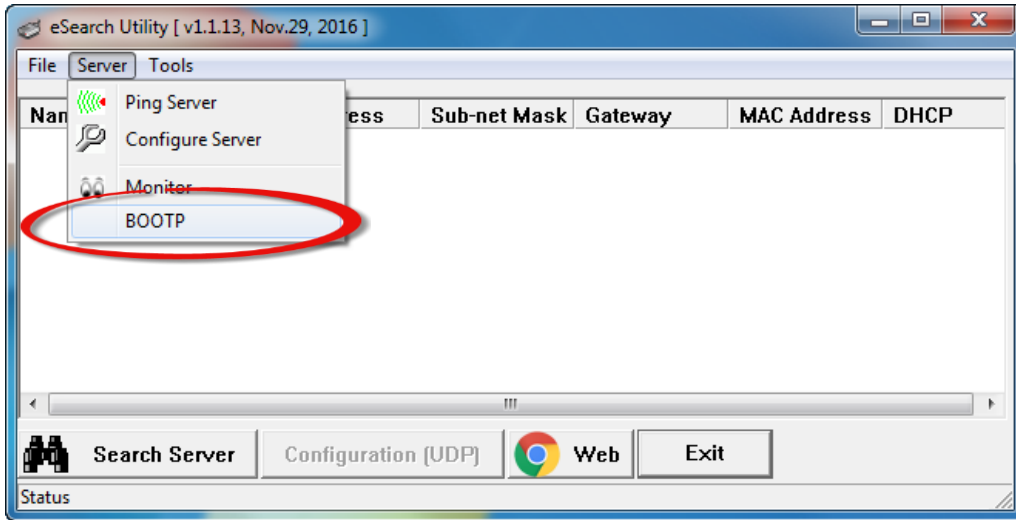

3.2 How to update Firmware when IP addresses of tSH-700_RevB and host PC are on different network segments?

The IP address of tSH-700_RevB module and Host PC, and the network access point (without passing through a router/gateway) must be in the same subnet for firmware update.

- If the network environment supports DHCP, you can refer to **Method 1** to set the IP for the module.
- Alternatively, you can contact the network administrator to obtain a set of valid static IP addresses, referring to **Method 2** to set the IP for the module.


Once the module's IP address is correctly configured, you can proceed with the firmware update.

Method 1: Using **“DHCP”** to automatically assigns an IP address to tSH-700_RevB module. Follow the procedure described below:


Note: Please consult your network administrator as this feature requires the presence of a DHCP server in the network environment.

Step 1: Run the eSearch Utility to search for tSH-700_RevB modules


Step 2: Double click the name of tSH-700_RevB to open the **“Configure Server (UDP)”** dialog box.

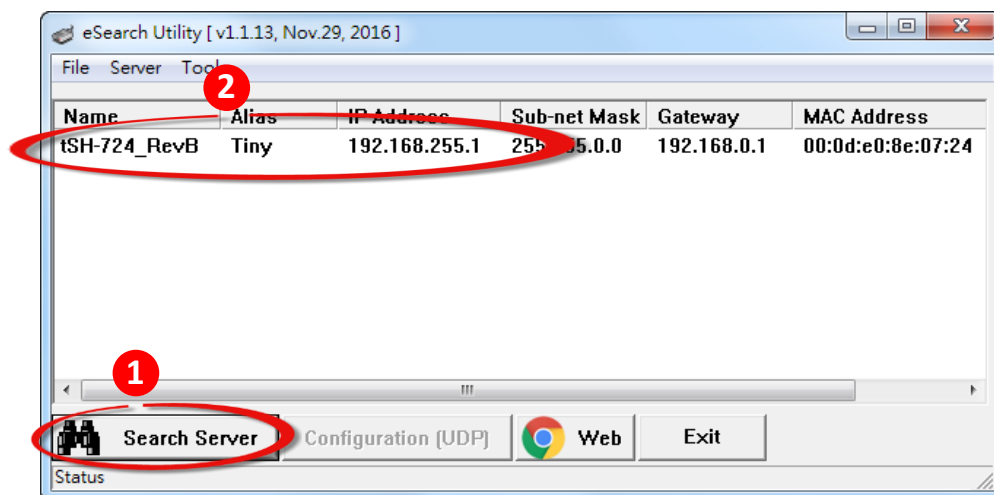

Step 3: Select the "1: ON" option from the "DHCP:" drop-down menu and click the "OK" button.

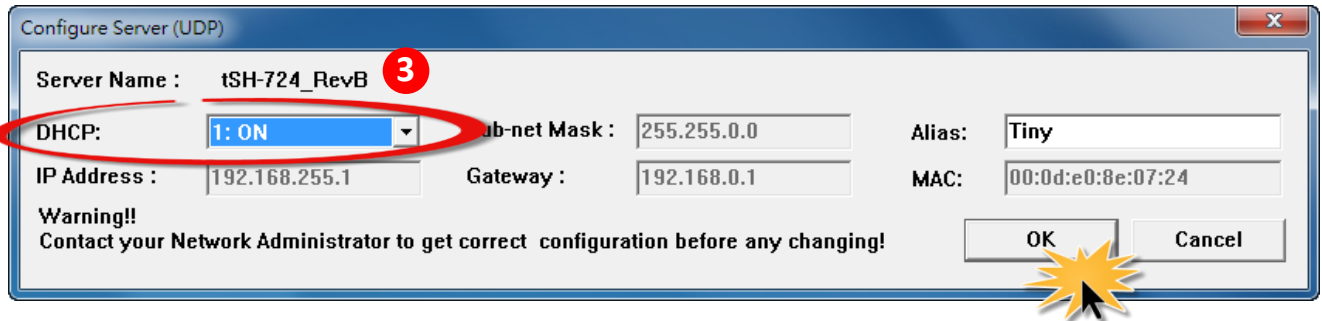


Step 4: Wait 2 seconds and then click the "Search Servers" button again to ensure the tSH-700_RevB is working well with new configuration.

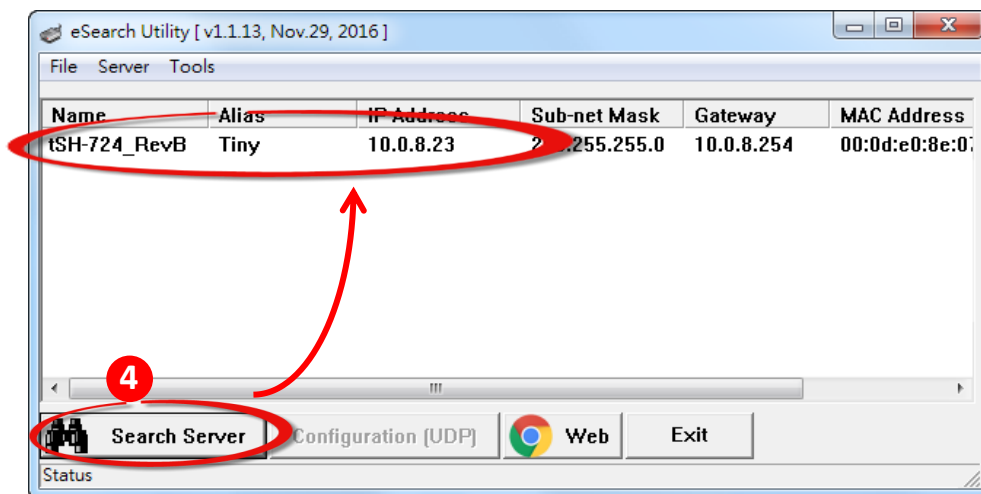


Step 5: Refer to "[Chapter 2-Firmware Update Procedure](#)" for details of how to complete the update process.

Method 2: Using **“Manual configuration”** to assigns an IP address to tSH-700_RevB series module. Follow the procedure described below:


- Step 1: Run the eSearch Utility to search for tSH-700_RevB modules
- Step 2: Double click the name of tSH-700_RevB to open the **“Configure Server (UDP)”** dialog box.

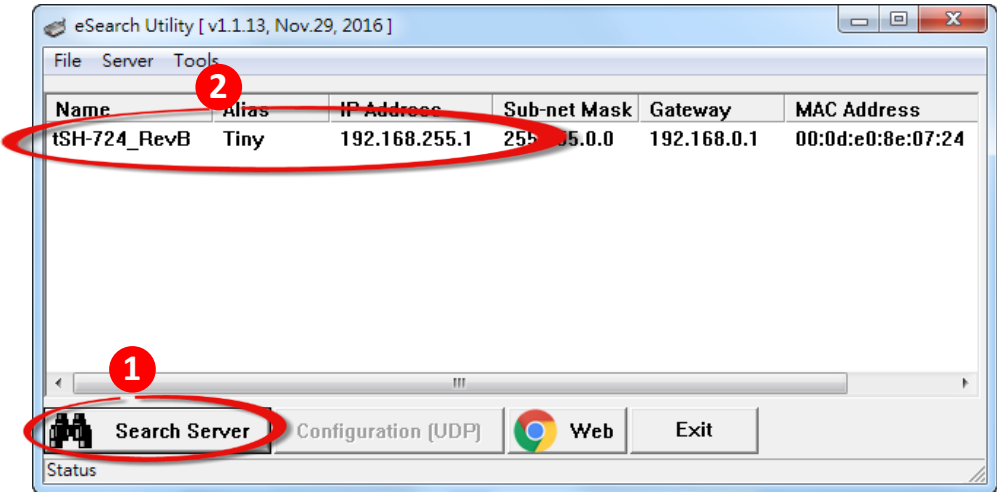

- Step 3: Select the **“0: OFF”** option from the **“DHCP:”** drop-down menu.
- Step 4: Contact your Network Administrator to obtain a correct network configuration (such as IP Address/Sub-net Mask/Gateway). Enter the network settings and click the **“OK”** button.

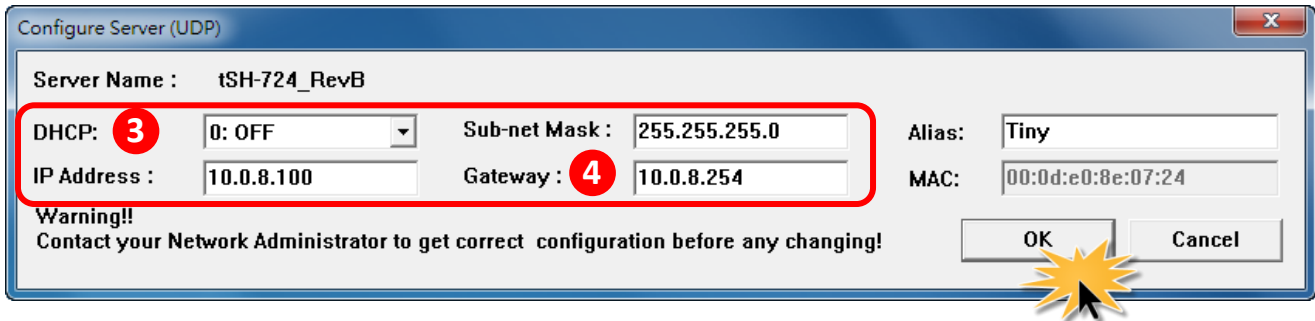


Step 5: Wait 2 seconds and then click the **“Search Servers”** button again to ensure the tSH-700_RevB is working well with new configuration.

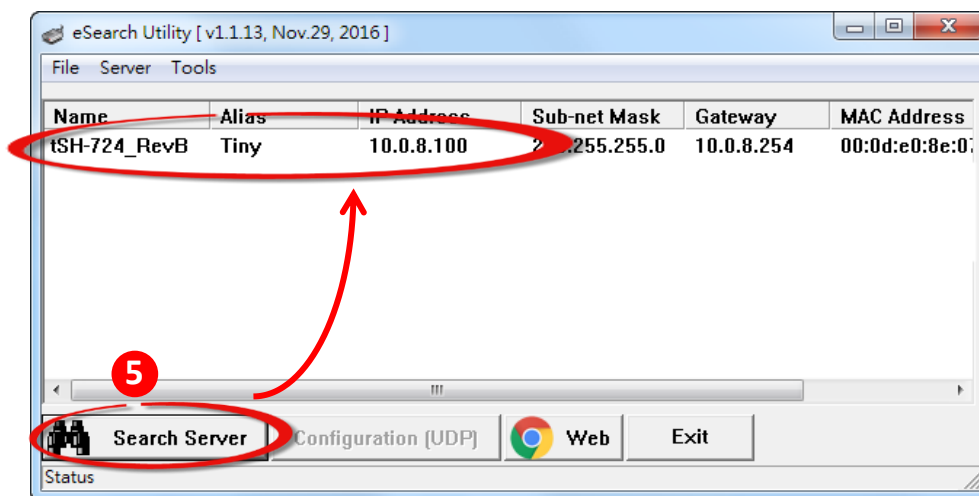

Step 6: Refer to **“Chapter 2-Firmware Update Procedure”** for details of how to complete the update process.

3.3 How to solve issues encountered during Firmware update

Issue 1: If the update progress is stuck at 0% with no response.

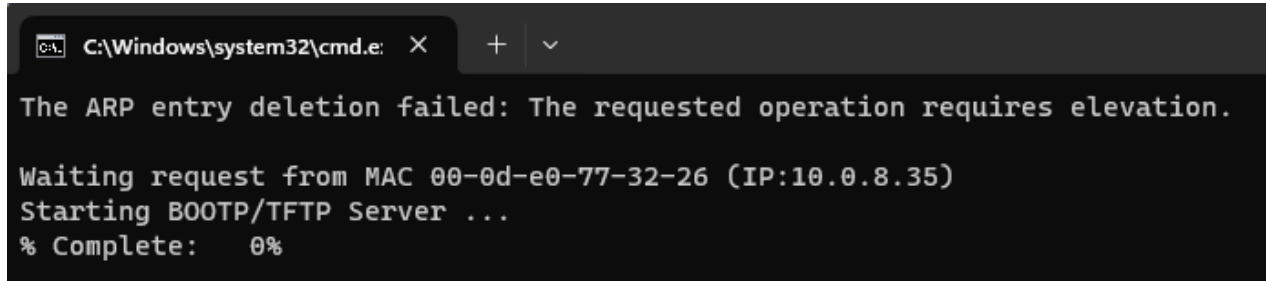

```
C:\Windows\system32\cmd.e: X + v
The ARP entry deletion failed: The requested operation requires elevation.
Waiting request from MAC 00-0d-e0-77-32-26 (IP:10.0.8.35)
Starting BOOTP/TFTP Server ...
% Complete: 0%
```


Solution: After completing the following steps, please Power-on reset the module.

Step 1: Please make sure that the Init/Run Switch of the module is in the "Init" position.

Step 2: Turn off the firewall and antivirus software.


Step 3: Make sure there is no multiple IPV4 configuration. (Refer to section 3.3, Question 2)

Issue 2: If there are multiple network adapters connected on the computer (LAN, Wi-Fi, VPN, VirtualBox, VMWare etc.), the following warning will appear during the subsequent eSearch firmware update.

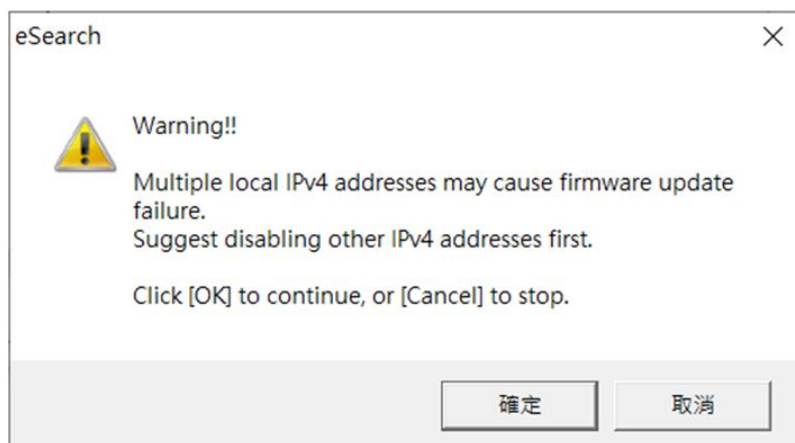

Solution: Please disable the other network interfaces, leave only the single one connected to the module. RUN the update process again.

Issue 3: When users fail to properly close the Command Prompt window during the Firmware update, it may result in the occupation of the Socket. Subsequently, when using eSearch to update Firmware, the following warning may appear.

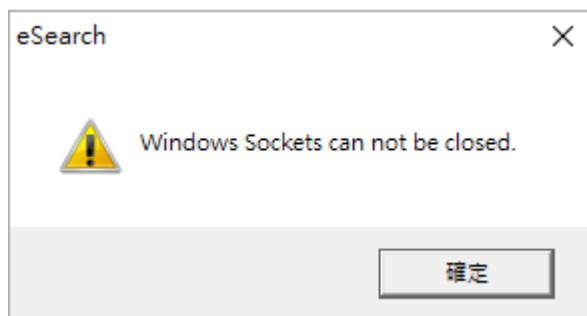


Solution: Please close the eSearch Utility and the Command Prompt window. Afterward, reopen the eSearch Utility and perform the update process again. If the warning message persists, please restart your computer.

If you encounter the aforementioned issues and all solutions fail, please refer to the following steps: Connect the module directly to the PC and perform the Firmware update without an external network connection.


Before starting the operation, please switch to a relatively clean computer environment. Users need to manually set an IP address to communicate with the tSH-700_RevB module connected to the same subnet.

Please refer to the instructions on how to set up the computer's IP: [How to Set a Static IP Address \(trendnet.com\)](https://www.trendnet.com/Support/FAQ/How-to-Set-a-Static-IP-Address)

Steps 1: Disable all network connections except for the one used to connect to the tSH-700_RevB module. In the example below, it is evident that Wi-Fi is not connected at this time.

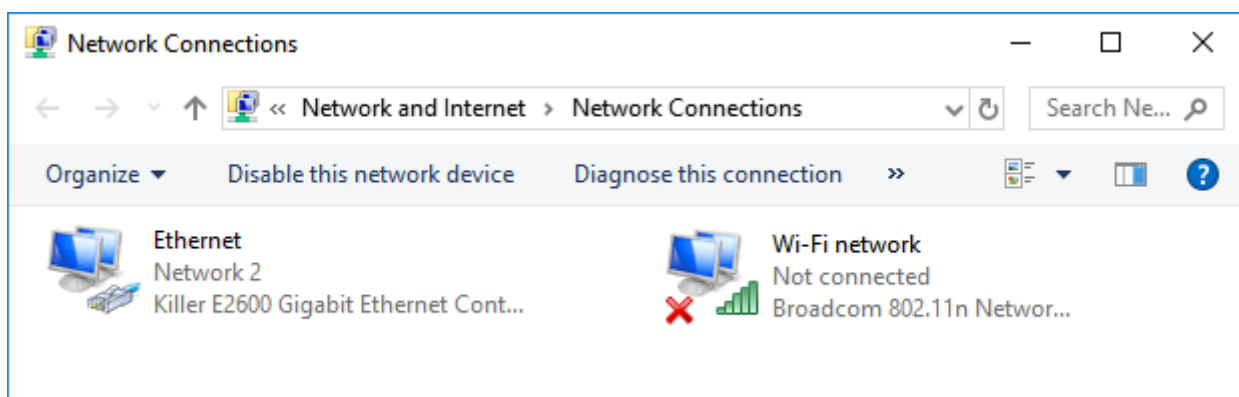

Steps 2: The module's default IP address is 192.168.255.1. Set your computer's IP address to something other than the module's setting, for example, 192.168.255.10.

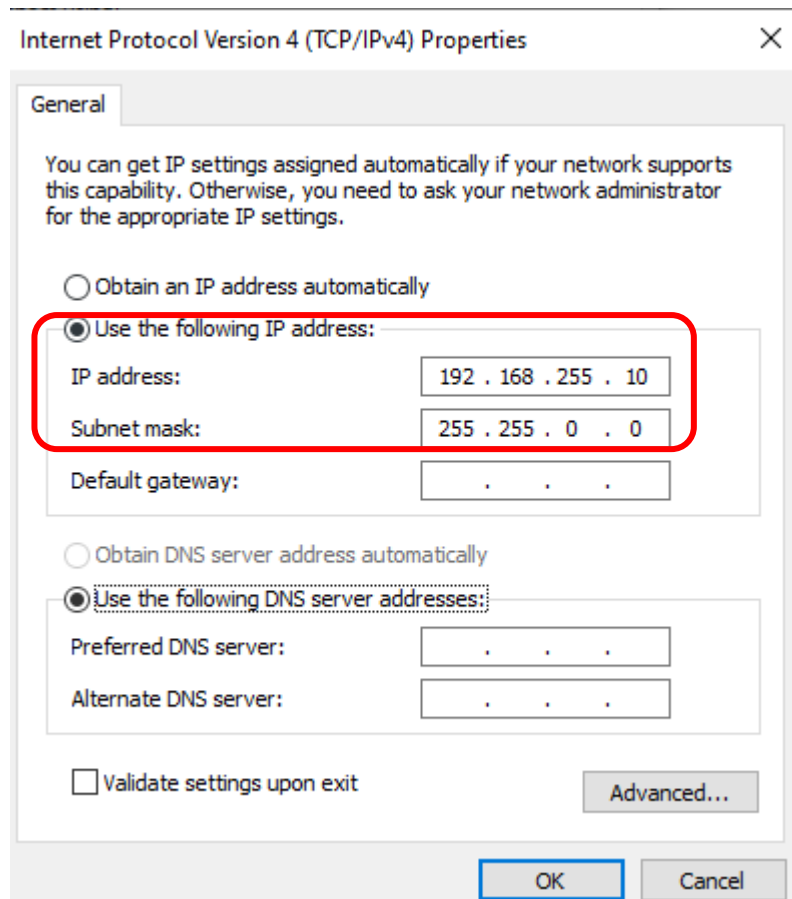

Steps 3: Please disable the firewall and antivirus software, and unplug all other network cables, leaving only the network cable connection between the tSH-700_RevB module and the computer.

Note: If the tSH-700_RevB module is powered via PoE, the PoE switch should not be connected to the external network. If the tSH-700_RevB module is powered via DC, simply connect one network cable to both the computer and the module

Subsequent steps, please refer to "Chapter 2 - Firmware Update Procedure" Steps 1 to 17 to complete the firmware update (subsequent update procedure steps are the same).

Note: In Step 5 on page 4, users can directly use the default IP 192.168.255.1 without making any changes.


4. Additional Information


The code contained in the boot loader, which is used to update the firmware image, is not part of the firmware it-self. This means that the firmware can still be updated even if the built-in firmware has been corrupted or does not exist. If the firmware update fails, simply execute the update procedure again in BOOTP mode, as described in Chapter 3, and the update should be successful.

The tSH-700_RevB series obtains the IP address assigned by the user and retrieves the firmware image through the utility program. Note that when updating the firmware, the tSH-700 RevB series uses the factory-default MAC address rather than any user-defined MAC addresses. The tSH-700_RevB series has a built-in flash protection feature that prevents any modifications from being made to the firmware stored in the flash memory, so before attempting to update the firmware, the Init/Run Switch should be set to the “Init” position and then the tSH-700_RevB series can be **Power-on reset** to disable the flash protection. Since the flash memory then becomes writable, the firmware can be updated via the Ethernet network.

Mode	Flash Protection	Firmware Update	Configuration
Init	No	Yes	Factory-default
Run	Yes	No	User-defined

Notes:


 **Note 1:** If the IP address settings do not work correctly (e.g. there is no response to a ping command), please contact your network administrator to obtain a valid IP address for the tSH-700_RevB series module. [back](#)

 **Note 2:** If the settings displayed in the IP address field of the firmware update window is incorrect or invalid (e.g. IP address: 0.0.0.0), then a valid IP address which in the same subnet must be manually specified for the tSH-700_RevB series in order to process the update operation. Please contact your network administrator to obtain a valid IP address before proceeding. [back](#)

Note 3: When updating the firmware, the factory-default MAC address is used rather than any user-defined MAC address. Thus, the MAC address (user-defined) displayed in the firmware update window may not be the one required. If this is the case, the factory-default MAC address should be manually entered into the MAC Address field, or the MAC address should be restored to the factory-default settings via the web configuration pages.

..... [back](#)

Note 4: The “**BOOTREQ from MAC: xx-xx-xx-xx-xx-xx**” message indicates there is a module with the factory-default MAC address “xx-xx...” that is asking for the firmware to be updated. The update process will not begin if a user-defined MAC address is assigned in the firmware update window, since the addresses do not match. If this situation occurs, repeat the update procedure and manually enter the factory-default MAC address in the firmware update window, as described in **Step 5 on Page 4**. The firmware update procedure is illustrated in the figure below.

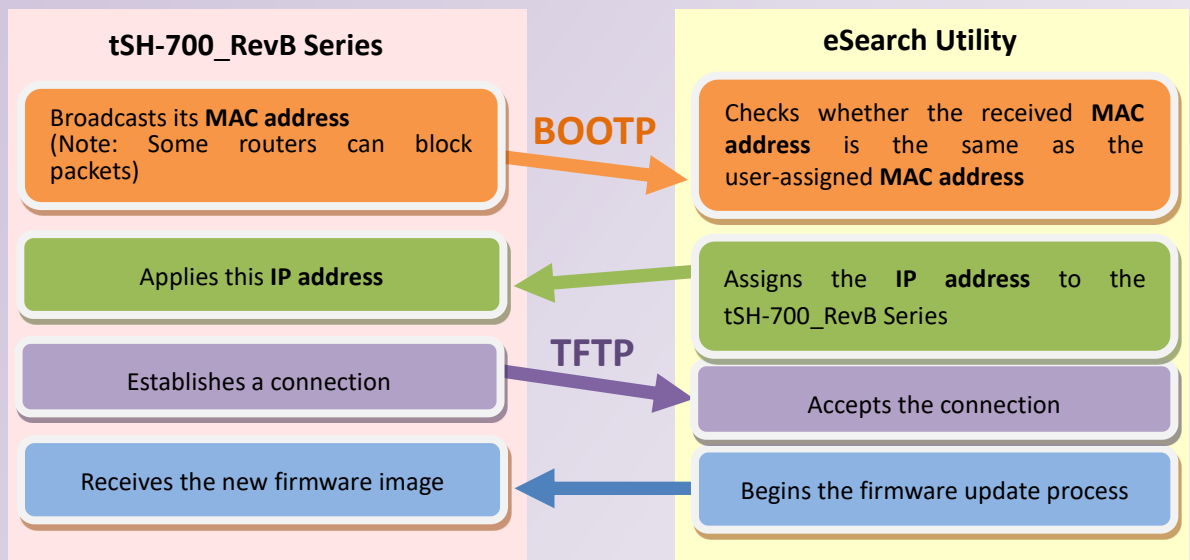

..... [back](#)

Note 5: The Bootstrap Protocol (BOOTP) is defined in RFC-951 and uses UDP ports 67 and 68.

Note6: The Trivial File Transfer Protocol (TFTP) is defined in RFC-1350 and uses UDP port 69.